

# CGEWHO- KENDRIYA VIHAR

Noida


# Site Details-

<b>Total Number of Elevators</b>	<b>93</b>
Product Type	Single Speed
Capacity	5 Passenger / 340 Kg
Stops / Openings	5 Stops / 5 Openings
Speed	0.63 mps
Installation Year	2003

# all back Details-(Jan 23- Oct 23)


Month	JAN-23	FEB-23	MAR-23	APR-23	MAY-23	JUN-23	JUL-23	AUG-23	SEP-23	OCT-23
Complaints	3	4	8	12	4	7	5	11	12	10

No. Of Complaints

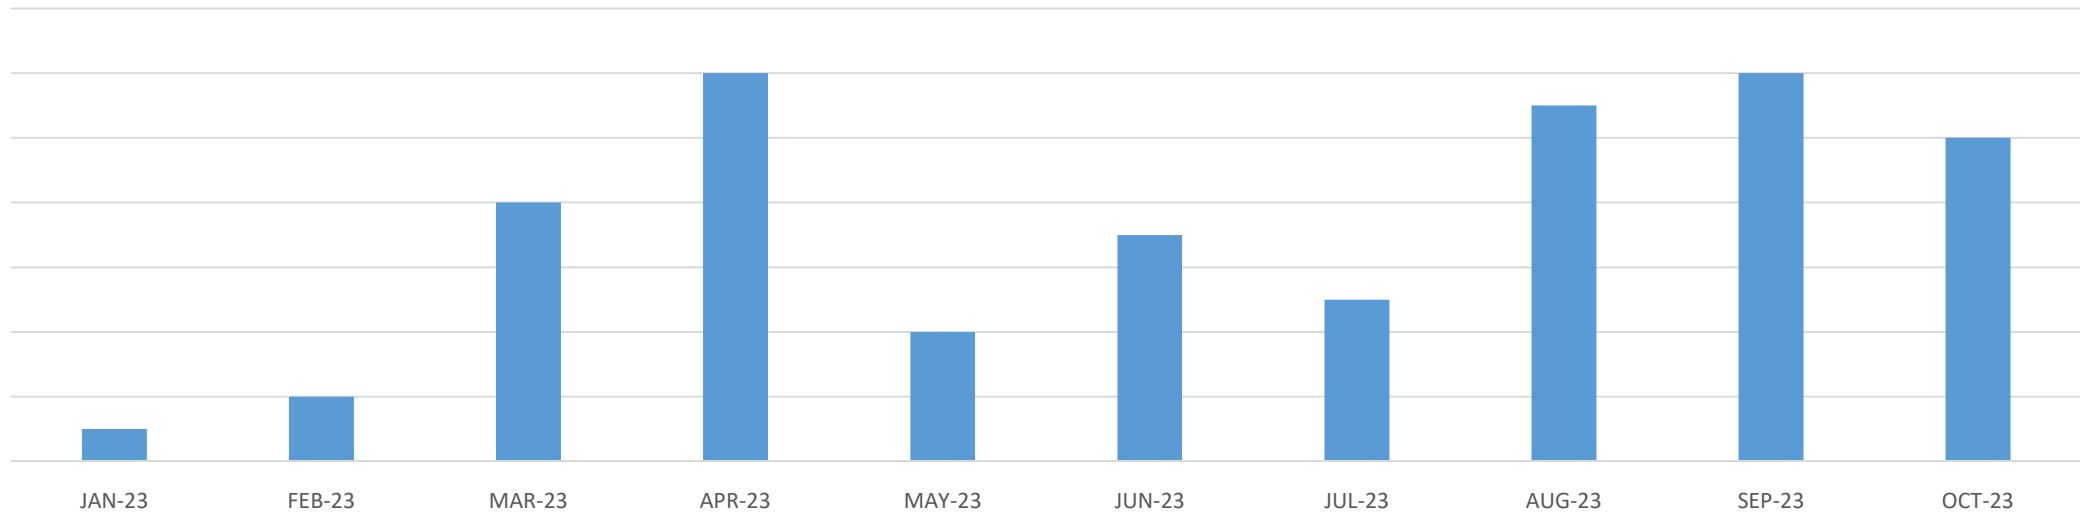


# Nature of Break down-

Reason for C/B	No. of C/B
Door Related	8
Load Sensing Problem	3
Flying CAM	7
Hoistway Limit	5
Machine Brake Issue	2
Power Supply Issue	3
JERKING	3
Controller PCB Defective (Misc)	11
Relay Defective	5
Door Lock Contact Defective	8
Pit Switch	4
Guide Shoe Related	6
Main MCB Related	2
Button COP/ HPI	8
Short Circuit	2

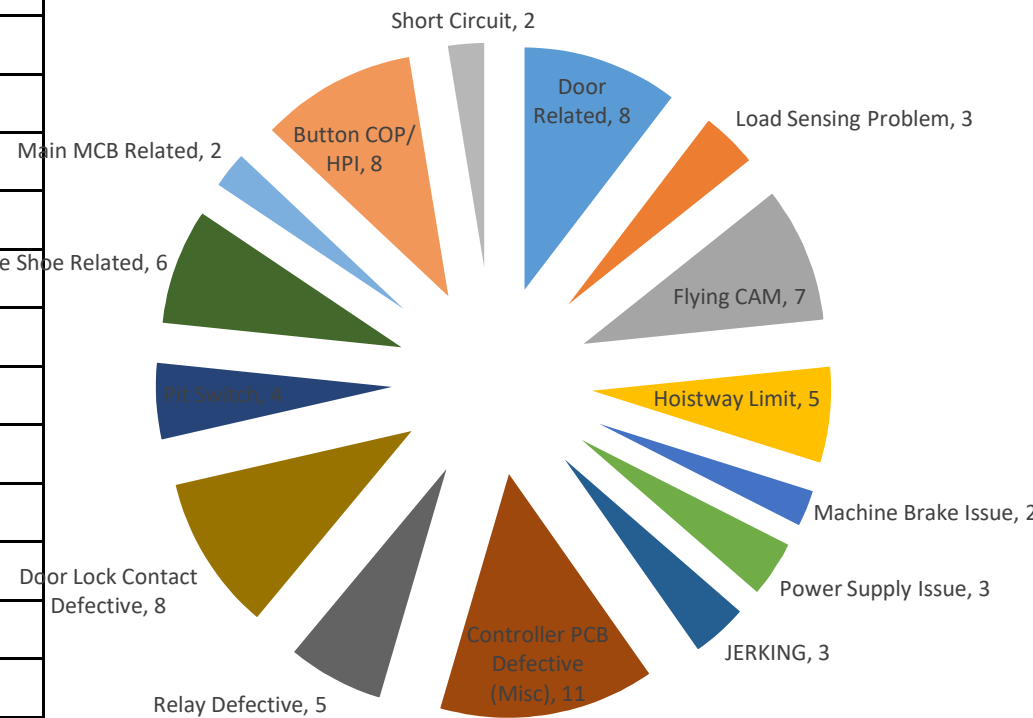

# Service Detail- Lift Wise (Jan – Sep 23)

Chart Title

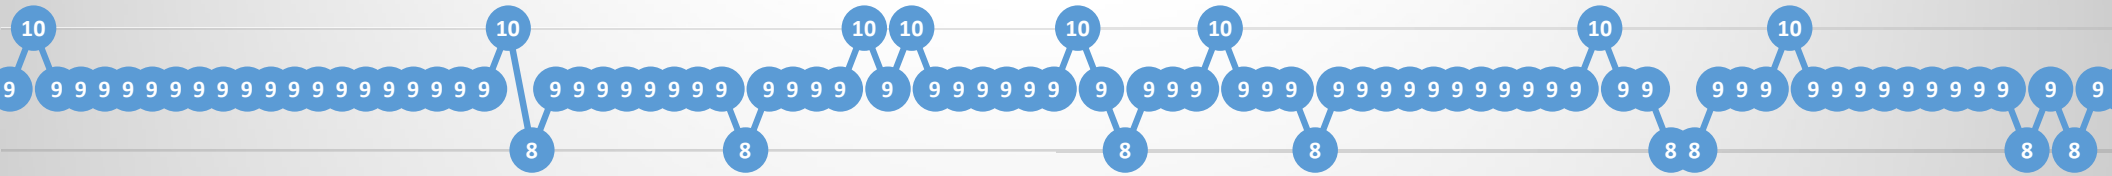

## Attachments :

1. Material Consumption details Lift wise
2. Complaint details – Lift Wise
3. Lift Maintenance Record Lift Wise

Detail from Oct 22- Sep 2023

Block NO	Machine No	CALLBACKS
1	J007531	3
2	J007532	4
3	J007533	2
4	J007534	3
5	J007535	2
6	J007536	4
7	J007537	2
8	J007538	2
9	J007539	1
10	J007540	1
11	J007541	4
12	J007542	3
13	J007543	2
14	J007544	4
15	J007545	2
16	J007546	2
17	J007547	2
18	J007548	2
19	J007549	1
20	J007550	3
21	J007551	2
22	J007552	1
23	J007553	1
24	J007554	0
25	J007555	0
26	J007556	1
27	J007557	0
28	J007558	1
29	J007559	3
30	J007560	3
31	J007561	1
32	J007562	0
33	J007563	2
34	J007564	1
35	J007565	0
36	J007566	3
37	J007567	0
38	J007568	1
39	J007569	1
40	J007570	0
41	J007571	0
42	J007572	0
43	J007573	0
44	J007574	0
45	J007575	0
46	J007576	0
47	J007577	0
48	J007578	0

49	J007579	0
50	J007580	2
51	J007581	0
52	J007582	0
53	J007583	0
54	L004460	0
55	L004461	0
56	L004462	0
57	L004463	0
58	L004464	3
59	L004465	0
60	L004466	1
61	L004467	4
62	L004468	2
63	L004469	2
64	L004470	3
65	L004471	2
66	L004472	0
67	L004473	0
68	L004474	0
69	L004475	0
70	L004476	0
71	L004477	3
72	L004478	2
73	L004479	0
74	L004480	0
75	L004481	0
76	L004482	0
77	L004483	0
78	L004484	0
79	L004485	0
80	L004486	0
81	L004487	0
82	L004488	0
83	L004489	0
84	L004490	0
85	L004491	0
86	L004492	0
87	L004493	0
88	L004494	3
89	L004495	0
90	L004496	0
91	L004497	0
92	L004498	3
93	L004499	0

## CALLBACKS

4


4

4

4

4



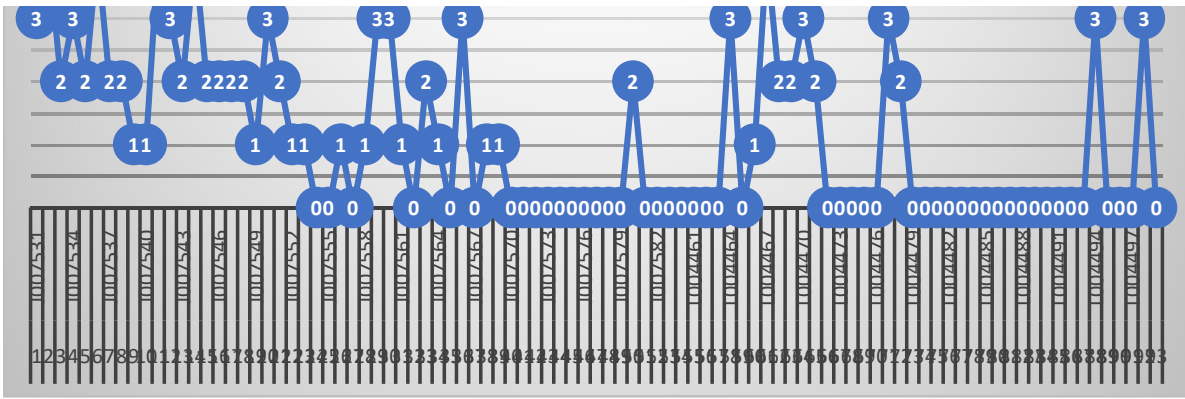

<b>Machine No</b>	<b>Service Done JAN- SEP-23</b>
J007531	10
J007532	9
J007533	9
J007534	10
J007535	9
J007536	9
J007537	9
J007538	9
J007539	9
J007540	9
J007541	9
J007542	9
J007543	9
J007544	9
J007545	9
J007546	9
J007547	9
J007548	9
J007549	9
J007550	9
J007551	9
J007552	9
J007553	9
J007554	10
J007555	8
J007556	9
J007557	9
J007558	9
J007559	9
J007560	9
J007561	9
J007562	9
J007563	9
J007564	8
J007565	9
J007566	9
J007567	9
J007568	9
J007569	10
J007570	9
J007571	10
J007572	9
J007573	9
J007574	9
J007575	9

J007576	9
J007577	9
J007578	10
J007579	9
J007580	8
J007581	9
J007582	9
J007583	9
L004460	10
L004461	9
L004462	9
L004463	9
L004464	8
L004465	9
L004466	9
L004467	9
L004468	9
L004469	9
L004470	9
L004471	9
L004472	9
L004473	9
L004474	9
L004475	9
L004476	10
L004477	9
L004478	9
L004479	8
L004480	8
L004481	9
L004482	9
L004483	9
L004484	10
L004485	9
L004486	9
L004487	9
L004488	9
L004489	9
L004490	9
L004491	9
L004492	9
L004493	9
L004494	8
L004495	9
L004496	8
L004497	9
L004498	9



Description 1	Quantity	Machine No	Building Name	Request Date	Order Date	Block No
RAIL CL OIL ENKLO150 1LT TIN	1	J007531	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	11/28/2022	11/28/2022	1
RAIL CL OIL ENKLO150 1LT TIN	4	J007531	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	11/28/2022	11/28/2022	1
Safety KIT	1	J007531	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	12/18/2022	12/18/2022	1
BUSH FOR GETM5.5 BRAKE COIL	1	J007531	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/21/2023	4/21/2023	1
GREASE [9LU10B] 100GMS	-10	J007531	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	5/6/2023	5/6/2023	1
L LOCK	1	J007531	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	7/17/2023	7/17/2023	1
L LOCKS	1	J007531	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	8/21/2023	8/21/2023	1
RAIL CL OIL ENKLO150 1LT TIN	10	J007532	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	8/5/2022	8/5/2022	2
TERMINAL BASE ASSY.	1	J007532	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	9/26/2022	9/26/2022	2
TERMINAL BASE ASSY.	2	J007532	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	9/26/2022	9/26/2022	2
PUSH BUTTON ASSLY	1	J007532	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/20/2023	4/20/2023	2
PIEZO BUZZER [DO BELL] 24V DC	1	J007534	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	5/4/2023	5/4/2023	4
PUSH BUTTON ASSLY	1	J007535	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/21/2023	4/21/2023	5
OVERLOAD RELAY	1	J007535	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/21/2023	4/21/2023	5
CNX PANEL	1	J007536	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/29/2023	3/29/2023	6
PSC	1	J007536	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	7/17/2023	7/17/2023	6
OVERLOAD RELAY	1	J007536	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	8/4/2023	8/4/2023	6
FIRST AID KIT	1	J007537	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	9/29/2022	9/29/2022	7
CNX PANEL	1	J007537	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/29/2023	3/29/2023	7
PUSH BUTTON ASSLY	1	J007537	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	5/4/2023	5/4/2023	7
RAIL CL OIL ENKLO150 1LT TIN	5	J007538	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	11/14/2022	11/14/2022	8
CNX PANEL	1	J007538	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/29/2023	3/29/2023	8
PIEZO BUZZER [DO BELL] 24V DC	3	J007538	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	5/23/2023	5/23/2023	8
RAIL CL OIL ENKLO150 1LT TIN	5	J007538	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	7/10/2023	7/10/2023	8
CNX PANEL	1	J007539	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/29/2023	3/29/2023	9
OVERLOAD RELAY	1	J007539	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	6/19/2023	6/19/2023	9
RAIL CL OIL ENKLO150 1LT TIN	5	J007539	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	7/10/2023	7/10/2023	9
TERMINAL BASE ASSY.	3	J007540	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	9/26/2022	9/26/2022	10
RAIL CL OIL ENKLO150 1LT TIN	5	J007540	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	11/14/2022	11/14/2022	10
Switch	2	J007540	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/22/2023	3/22/2023	10
C.R.PANEL	2	J007541	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	2/23/2023	2/23/2023	11
Switch	2	J007541	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/22/2023	3/22/2023	11
Fuse 3 AMP 250V 1 1/4x1/4	10	J007542	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/22/2023	3/22/2023	12
Switch	2	J007542	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/22/2023	3/22/2023	12
ELECTRONIC HOOTER	1	J007542	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/22/2023	3/22/2023	12
C.R.PANEL	2	J007543	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	2/23/2023	2/23/2023	13
SSCP	1	J007545	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	2/15/2023	2/15/2023	15
Relay-110VDC-(P3-3)	2	J007545	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	2/15/2023	2/15/2023	15
SSCP	1	J007545	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/21/2023	4/21/2023	15
SSCP	1	J007546	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	2/15/2023	2/15/2023	16
ROLLER ASSEMBLY	23	J007550	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	1/12/2023	1/12/2023	20
ROLLER ASSEMBLY	2	J007550	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	1/12/2023	1/12/2023	20
CNX PANEL	1	J007550	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/29/2023	3/29/2023	20
CNX PANEL	1	J007551	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/7/2023	4/7/2023	21
C.R.PANEL	2	J007551	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/21/2023	4/21/2023	21
Switch	4	J007551	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/21/2023	4/21/2023	21
Fuse 3 AMP 250V 1 1/4x1/4	10	J007552	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	22
Switch	4	J007552	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	22
C.R.PANEL	1	J007552	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	22
C.R.PANEL	1	J007552	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	22
SSCP	2	J007552	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	22
Fuse 3 AMP 250V 1 1/4x1/4	10	J007553	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	23
Switch	4	J007553	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	23
C.R.PANEL	2	J007553	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	23
SSCP	2	J007553	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	23
Fuse 3 AMP 250V 1 1/4x1/4	10	J007554	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	24
Switch	4	J007554	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	24
C.R.PANEL	2	J007554	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	24
SSCP	2	J007554	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	24
Relay-110VDC-(P3-3)	2	J007555	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	2/16/2023	2/16/2023	25
Fuse 3 AMP 250V 1 1/4x1/4	10	J007555	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	25
Switch	4	J007555	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	25
C.R.PANEL	2	J007555	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	25
SSCP	2	J007555	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/27/2023	4/27/2023	25

PSC	1	J007556	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/1/2023	4/1/2023	26
J RELAY PANEL	1	J007557	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/21/2023	4/21/2023	27
PIT SWITCH	2	J007557	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/21/2023	4/21/2023	27
PUSH BUTTON ASSLY	1	J007557	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/21/2023	4/21/2023	27
PSC	1	J007557	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/21/2023	4/21/2023	27
ROLLER ASSEMBLY	3	J007560	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/27/2023	3/27/2023	30
ROLLER ASSEMBLY	17	J007560	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/27/2023	3/27/2023	30
CONTACTS SUB ASSLY.	10	J007560	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/27/2023	3/27/2023	30
CNX PANEL	1	J007561	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/1/2023	4/1/2023	31
J RELAY PANEL	1	J007561	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/7/2023	4/7/2023	31
PIT SWITCH	1	J007564	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/29/2023	3/29/2023	34
CONTACTS SUB ASSLY.	2	J007565	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	10/11/2022	10/11/2022	35
CONTACTS SUB ASSLY.	1	J007565	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	10/11/2022	10/11/2022	35
PIT SWITCH	1	J007565	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/29/2023	3/29/2023	35
J RELAY PANEL	1	J007566	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/21/2023	4/21/2023	36
PIT SWITCH	1	J007569	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/29/2023	3/29/2023	39
PIT SWITCH	1	J007570	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/29/2023	3/29/2023	40
SSCP	1	J007575	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	2/15/2023	2/15/2023	45
RAIL CL OIL ENKLO150 1LT TIN	10	J007576	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	8/12/2022	8/12/2022	46
OVERLOAD RELAY	1	J007579	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/20/2023	4/20/2023	49
ROLLER ASSEMBLY	25	J007580	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	1/14/2023	1/14/2023	50
PIT SWITCH	1	J007581	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/29/2023	3/29/2023	51
RAIL CL OIL ENKLO150 1LT TIN	10	L004463	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	8/8/2022	8/8/2022	57
TRANSFORMER	1	L004464	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	5/2/2023	5/2/2023	58
PIT SWITCH	1	L004465	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/29/2023	3/29/2023	59
PIT SWITCH	1	L004466	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	3/29/2023	3/29/2023	60
RAIL CL OIL ENKLO150 1LT TIN	10	L004469	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	8/12/2022	8/12/2022	63
RAIL CL OIL ENKLO150 1LT TIN	5	L004470	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	11/14/2022	11/14/2022	64
RAIL CL OIL ENKLO150 1LT TIN	10	L004472	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	8/12/2022	8/12/2022	66
PCB FOR HPI SINGLE DIGIT (GEM)	1	L004472	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	9/29/2022	9/29/2022	66
RAIL CL OIL ENKLO150 1LT TIN	10	L004473	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	8/12/2022	8/12/2022	67
PCB FOR HPI SINGLE DIGIT (GEM)	1	L004473	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	10/6/2022	10/6/2022	67
PCB FOR HPI SINGLE DIGIT (GEM)	1	L004474	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	10/11/2022	10/11/2022	68
RAIL CL OIL ENKLO150 1LT TIN	5	L004475	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	11/14/2022	11/14/2022	69
11 VTR WORM GEAR (22:1)	1	L004478	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	6/9/2023	6/9/2023	72
BALL BEARING 6304 2Z	1	L004478	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	6/12/2023	6/12/2023	72
BEARING 6211-2RS1/DBGA-2#(PAIR	1	L004478	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	6/12/2023	6/12/2023	72
FAN GRILL ANODISED	1	L004480	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	10/5/2022	10/5/2022	74
OVERLOAD RELAY	1	L004480	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	8/4/2023	8/4/2023	74
FAN GRILL ANODISED	1	L004485	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	10/5/2022	10/5/2022	79
TERMINAL BASE ASSY.	1	L004486	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	8/21/2023	8/21/2023	80
C.R.PANEL	1	L004487	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/3/2023	4/3/2023	81
SSCP	1	L004487	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/3/2023	4/3/2023	81
C.R.PANEL	1	L004487	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/6/2023	4/6/2023	81
SSCP	1	L004487	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/6/2023	4/6/2023	81
C.R.PANEL	1	L004488	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/7/2023	4/7/2023	82
SSCP	1	L004488	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/7/2023	4/7/2023	82
C.R.PANEL	2	L004489	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/4/2023	4/4/2023	83
SSCP	2	L004489	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/4/2023	4/4/2023	83
CONTACT SUPPORT	2	L004490	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/28/2023	4/28/2023	84
CONTACT ASSY.	2	L004490	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/28/2023	4/28/2023	84
CONTACT ASSY.	2	L004490	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/28/2023	4/28/2023	84
PCB FOR HPI DOUBLE DIGIT (GEM)	2	L004492	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	9/29/2022	9/29/2022	86
PCB FOR HPI DOUBLE DIGIT (GEM)	1	L004494	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	10/6/2022	10/6/2022	88
J RELAY PANEL	1	L004495	52MJ7531-KENDRIYA VIHAR-II APPT OWNER'S	4/21/2023	4/21/2023	89